

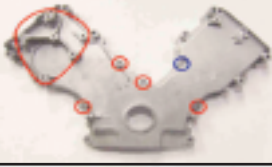
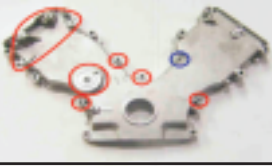





Years	Vehicle Type	Engine Plant	Casting Number	OEM PN	EDS.com PN	Comments	Illustration
1991-92	Pass	Romeo	F1AE F2AE	F1AZ-6019-A	FF4601	Does not have any cast and drilled bosses for tensioner. Has 15 small 8.0mm mounting bolt holes.	
1992-95	Pass	Romeo	F3AE F5AE	F5AZ-6019-A	FF4602	Has six cast and drilled bosses for tensioner. Has 15 small 8.0mm mounting bolt holes.	
1996-00	Pass	Romeo <i>Windsor when used</i>	F6AE F7AE F7ZE F8ZE	F8ZZ-6019-CA	FF4603	Has six cast and drilled bosses for tensioner, 10 (large) 10.0mm bolt and 5 (small) 8.0mm mounting bolt holes. Mounting bolt location by water pump is .250" higher than prior years.	
1999-2000 Mustang	Pass	Windsor	XR3E-BB	XR3Z-6019-BA	FF4604	Has revised four bolt boss mount for tensioner, 10 (large) 10.0mm bolt and 5 (small) 8.0mm mounting bolt holes. Same as FF4605/CN 2W7E	
2001-03	Pass	Romeo	2W7E	2W7Z-6019-AA	FF4605	Has revised four bolt boss mount for tensioner, 10 (large) 10.0mm bolt and 5 (small) 8.0mm mounting bolt holes. Same as FF4604/CN XR3E-BB	
1997-2001	Truck Expedition	Romeo <i>Windsor when used</i>	F65E	F65Z-6019-AB	FF4606	Has six cast and drilled bosses for tensioner in a different pattern. Has 10 (large) 10.0mm bolt and 5 (small) 8.0mm mounting bolt holes.	
1999-2003	Van	Romeo <i>Windsor when used</i>	2L3E	2L3Z-6019-AA	FF4607	Has six cast and drilled bosses for tensioner in a different pattern. Has 10 (large) 10.0mm bolt and 5 (small) 8.0mm mounting bolt holes, MOM but does not use advance pointer can be used for FF4608/CN 2L3E	
2002-04	Truck	Romeo <i>Windsor when used</i>	2L3E	2L3Z-6019-AA	FF4608	Has six cast and drilled bosses for tensioner in a different pattern. Has 10 (large) 10.0mm bolt and 5 (small) 8.0mm mounting bolt holes, MOM have but does use the 30° advance pointer can be used for FF4607/CN 2L3E.	
2002-05 2003-05 2004-05	Explorer Expedition Truck	Romeo <i>Windsor when used</i>	1L2E 2L1E 2L2E 3L3E	2L1Z-6019-BA 2L2Z-9019-AA 2L2Z-9019-AA 3L3Z-6019-AA	FF4609	Has high mount power steering pump on drivers side with boss changes for mounting, Belt idler mounting location added. Best information available is that all high pump covers are the same.	